

Technical Bulletin



Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Passat, Passat Wagon	2006 > 2007	All	All	All	All

Condition

70 07 04 Feb. 19, 2007, 2013575

Rear Door Trim Panel Rattle

Rattling noises from the rear door trim.

Technical Background



Insufficient tension of the attachment between door trim and inner door panel -arrows-.

Production Solution

Application of felt strips on the inner door panel.

Technical Bulletin




Service

Apply felt strips on the inner door panel




 Tip:

Before removing the rear door trim mark the installation position (green line) with a water-soluble pen or tape. Ensure that the felt strips do not protrude from under door trim once installed.

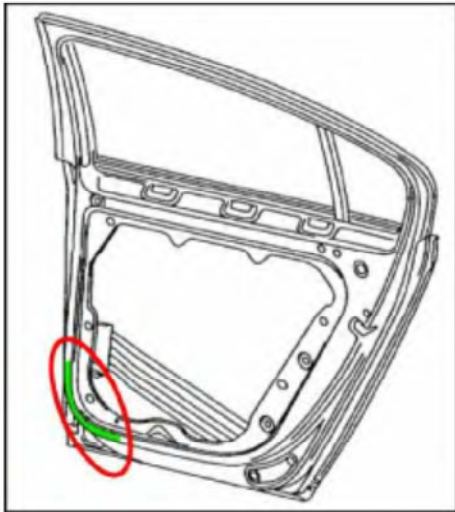

- Remove the rear door trim. See ElsaWeb, Repair Manual Group 70.
- Cut felt strip, See [Required Parts and Tools](#) into 280 mm strips (one felt strip per door).
- Apply felt strips at green area -red ellipse- on the inner door panel using the water-soluble pen or tape marks as a guide.
- Remove the water-soluble pen or tape marks on the inner door panel.
- Reinstall the rear door trim. See ElsaWeb, Repair Manual Group 70.

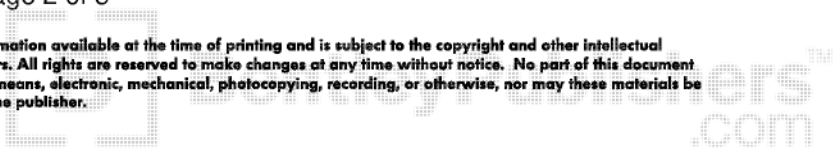

Technical Bulletin



Warranty

When procedure applies to vehicles within the New Vehicle Limited Warranty, use the following:	
Claim Type:	W2
Part Identifier:	7073
Damage Code:	7073 20 ___ * 1
Labor Operation: One Door	70734199 Maximum A-Time allowed = 50 TU
Labor Operation: Two Doors	70734299 Maximum A-Time allowed = 90 TU
Sublet Cost: One Door	\$2.00 Max
Sublet Cost: Two Doors	\$4.00 Max
Diagnostic Time:	No Additional Diagnostic Time Allowed
Claim Comment: Input "As per Technical Bulletin 2013575" in comment section of Warranty Claim.	

* Code per warranty vendor code policy.

Required Parts and Tools

Description	Part No:	Quantity
Felt Strip (self-adhesive)	533863288A	1 or 2



Tip:

Part number(s) are for reference only. Always see ETKA for the latest part(s) information.