

Technical Bulletin



Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Passat Sedan	2006 - 2008	All	All	All	All

Condition

68 08 01 Mar. 13, 2008 2017463

Sunshade, Back Glass, Damaged or Will Not Operate Properly

Manually operated back glass sunshade does not slide smoothly, or sunshade will not latch in up position.

 **Note:**

DO NOT replace manual sunshade assembly for this condition.

Sunshade assembly does not have to be removed from vehicle for this repair.

Technical Background

One or both sunshade friction pads may be broken causing sunshade to track outside retaining rails. Sunshade handle may also be broken due to increased effort.

 **Note:**

This bulletin ONLY applies to manual sunshade.

Production Solution

No production change required.

Service

Replace one or both friction pads and handle (as required) following the procedure below:

- Fold rear seat backs down and install protective cover.
- Remove both "C" pillars and both sunshade guiding rails, see Repair Manual Group 68 Interior Equipment, Sunshade Removing and Installing in ElsaWeb.
- Pull sunshade toward the front of the vehicle and restrict the re-wind ability by placing a shop towel between the sunshade webbing and recoil.
- Inspect and/or replace both sunshade friction pads, handle and handle screw cover as required.

Technical Bulletin



Friction Pad Replacement

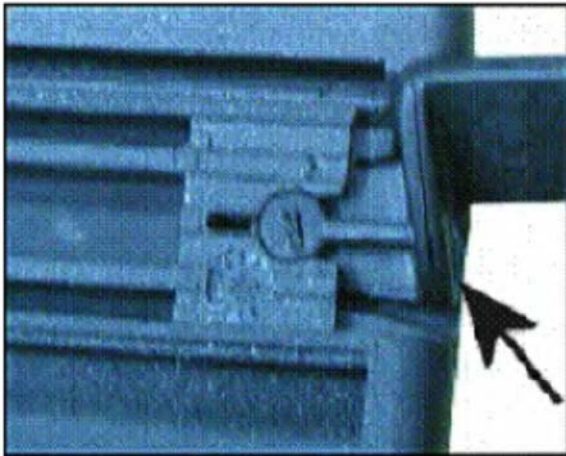


Figure 1



Tip:

This procedure applies to one or both sides.

- Using a flat blade screw driver, lift damaged or broken friction pad(s) up and away, see figure 1.
-

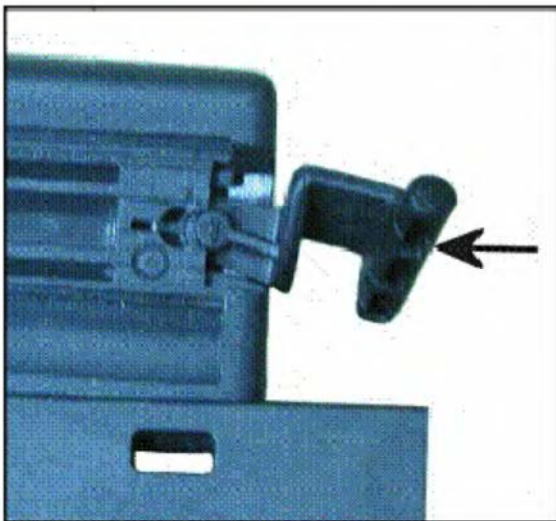


Figure 2

- Snap new friction pad(s) Part No. 3C0861597/598 in place, see figure 2.

Technical Bulletin



Handle Replacement

	<p>If sun shade handle is damaged, or if sun shade handle screw cap is missing, replace with the following:</p> <p>Handle Part No. 3C0862565 Cap Part No. 3C0861335</p> <ul style="list-style-type: none">• Remove cap• Remove screw and handle.
<p>Figure 3</p>	

Once repairs to sun shade are complete:

- Reassemble guide rails and both "C" pillars, see Repair Manual Group 68 Interior Equipment, Sunshade Removing and Installing in ElsaWeb.
- Ensure proper sun shade operation.



Tip:

When sunshade is in the up position, the handle must be tilted forward to allow for proper engagement into guide rail latch.

Technical Bulletin



Warranty

To determine if this procedure is covered under Warranty, always refer to the Warranty Policies and Procedures Manual ¹⁾					
Model(s)	Year(s)	Eng. Code(s)	Trans. Code(s)	VIN Range From	VIN Range To
Passat Sedan	2006 - 2008	All	All	All	All
Claim Type:		Use applicable Claim Type ¹⁾			
SAGA Coding					
Service Number:		Damage Code	Damage Location (Depends on Service No.)	Parts Manufacturer (removed part)	
6896		0015	41 = 1 side 42 = both	----- ²⁾	
Labor Operation ³⁾ : C- pillar trim removal and installation			70681900 = 30 TU		
Labor Operation ³⁾ : Includes all operations necessary to repair sun shade (handle, and/or right/left/both friction pad(s).			68964299 = 10 TU		
Diagnostic Time ⁴⁾					
GFF Time expenditure			01500000 = XX TU max.		NO
Road Test			01210002 & 01210004		NO
Technical Diagnosis			0132xxxx = XX TU max.		NO
Claim Comment: Input "As per Technical Bulletin 2017463" in comment section of Warranty Claim.					
¹⁾ Vehicle may be outside any Warranty in which case this Technical Bulletin is informational only ²⁾ Code per warranty vendor code policy. ³⁾ Labor Time Units (TUs) are subject to change with Elsa updates. ⁴⁾ Documentation required per Warranty Policy & Procedures Manual.					



Technical Bulletin



Required Parts and Tools

Part Description	Part No:	Quantity
Handle	3C0862565	1
Cap	3C0861335	1
Friction Pad (L).	3C0861597	1
Friction Pad (R)	3C0861598	1

No Special Tools required.

Additional Information

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.