# **Technical Bulletin**



Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
(A5) Jetta, Passat, Passat Wagon, GTI, Eos	2006-2008	2.0L (BPY)	All	All	All

### **Condition**

20 08 01 July 10, 2008 2018183

MIL ON, DTC P2293 Fuel Pressure Regulator 2 Performance Stored in ECM after Installing Replacement Engine

## **Technical Background**

High fuel pressure sensor (G247) on fuel rail of replacement engine does not match part number installed on original engine.

### **Production Solution**


N/A.

### Service

When changing a 2.0T FSI engine (BPY engine code), verify that the part number of high pressure sensor -G247-(#11) installed on fuel rail matches part number on engine that was removed.

# **Technical Bulletin**



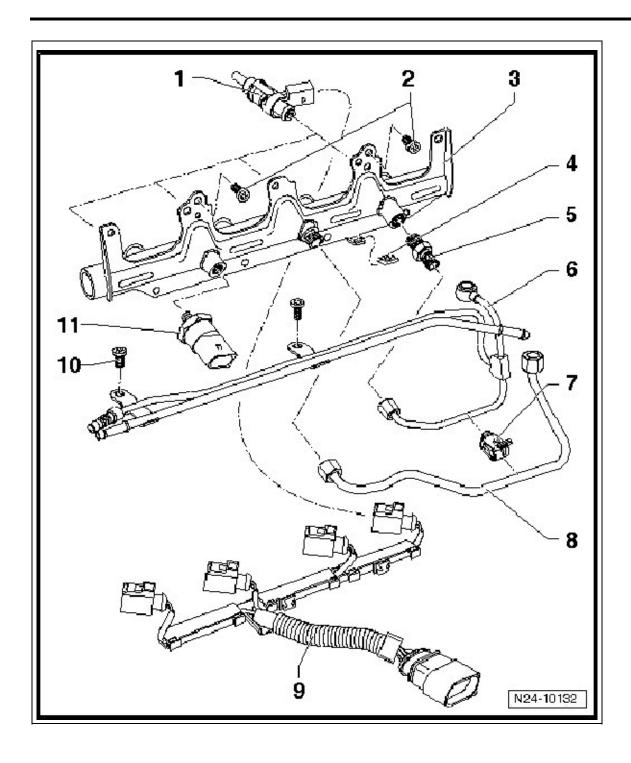

# **Technical Bulletin**



1. Cylinder 1	Fuel Injector –N30- to Cylinder 4
<b>Fuel Injector</b>	_N33-

2. Bolt (5 Nm)

3. Fuel Rail

4. Plate Nut

5. Pressure Relief Valve (30 Nm)

6. Fuel Pipe

7. Bracket

8. Fuel Pipe

9. Connector

10. Bolt (7 Nm)

11. Fuel Pressure Sensor -G247- (20 Nm)

## Warranty

Information Only.

## **Required Parts and Tools**

No Special Parts required.

No Special Tools required.

#### **Additional Information**

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.