

Technical Bulletin



Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
(A5) Jetta, Eos, GTI, Passat, Passat Wagon	2006-2008	2.0L (BPY)	All	All	All

Condition


20 08 05 Jul. 21, 2008 2017718

EVAP Purge Valve -N80-, Replacement

Diagnosis leads to EVAP purge valve -N80- replacement.

Technical Background

New design vent hose Part No. 8P0133781B for EVAP purge valve -N80- to improve EVAP system performance.

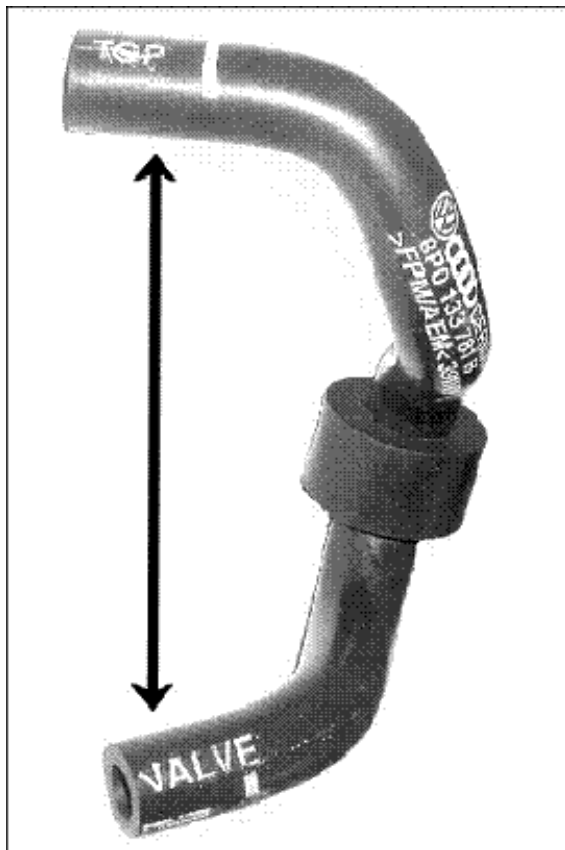

Note:

Vent hose Part No. 8P0133781B is clearly marked to ensure correct installation.

Slide hose onto pipe and valve, at a minimal, up to painted white line on hose before clamping.

Ensure new vent hose is not bent, twisted or chaffing other components.

Technical Bulletin




Production Solution

Repair identified after end of production.

Service

Whenever diagnosis leads to EVAP purge valve -N80- replacement, inspect and ensure installation of new, -N80- valve vent hose Part No. 8P0133781B.

Secure new valve vent hose with spring clamps Part No. N10199201.

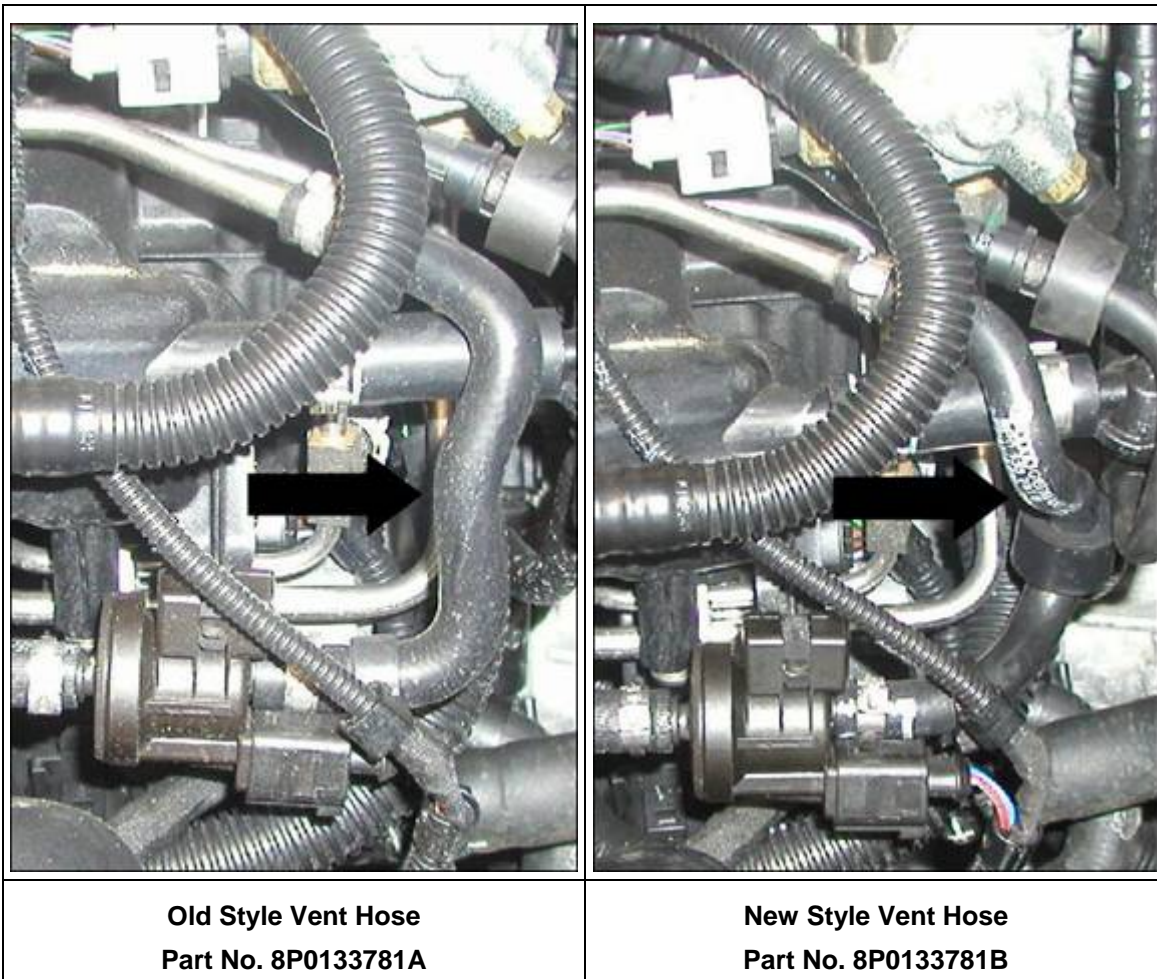

Technical Bulletin



Warranty

Information only.

Required Parts and Tools

Part Description	Part No:	Quantity
Vent Hose	8P0133781B	1
Spring Clamp	N10199201	As required

No Special Tools Required.

Additional Information

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.